

EXECUTIVE SUMMARY

Thank you for your continued hard work sampling **Horseshoe Pond** this year! We congratulate your group for sampling your pond **once** this summer. However, we strongly encourage your monitoring group to sample **additional** times each summer. Typically, we recommend that monitoring groups sample **three times** per summer (once in **June, July**, and **August**). We understand that the number of sampling events you decide to conduct per summer will depend upon volunteer availability, and your monitoring group's goals and funding availability. However, with a limited amount of data it is difficult to determine accurate and representative water quality trends. Since weather patterns and activity in the watershed can change throughout the summer, from year to year, and even from hour to hour during a rain event, it is a good idea to sample the pond at least once per month during the summer.

If you are having difficulty finding volunteers to help sample or to travel to one of the laboratories, please call the VLAP Coordinator and DES will help you work out an arrangement.

OBSERVATIONS & RECOMMENDATIONS

DEEP SPOT

➤ **Chlorophyll-a**

Chlorophyll-a, a pigment found in plants, is an indicator of algal or cyanobacteria abundance. Algae are typically microscopic plants that are naturally found in the lake ecosystem. The measurement of chlorophyll-a in the water gives biologists an estimation of the algal concentration or lake productivity. Table 14 in Appendix A lists the current year chlorophyll-a data.

Figure 1 depicts the historical and current year chlorophyll-a concentration in the water column.

The median summer chlorophyll-a concentration for New Hampshire's lakes and ponds is 4.58 mg/m³.

The current year data (the top graph) show that the chlorophyll-a concentration was **42.70 mg/m³** in **June** indicating an algal bloom had occurred in the pond. Typically, chlorophyll-a concentrations above **15.0 mg/m³** are indicative of an algal bloom.

The historical data (the bottom graph) show that the **2009** chlorophyll-a mean is ***much greater than*** the state and similar lake medians. For more information on the similar lake median, refer to Appendix D.

Overall, visual inspection of the historical data trend line (the bottom graph) shows an ***increasing*** in-lake chlorophyll-a trend since monitoring began. Specifically the mean chlorophyll concentration has ***worsened*** since **2006**.

Please keep in mind that this observation is based on only ***three non-consecutive*** years of ***limited*** data. After 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the historical data to objectively determine if there has been a significant change in the annual mean transparency since monitoring began.



While algae are naturally present in all waterbodies, an excessive or increasing amount of any type is not welcomed. Phosphorus is the nutrient that algae typically depend upon for growth in New Hampshire lakes and ponds. Algal concentrations increase as nonpoint sources of phosphorus from the watershed increase, or as in-lake phosphorus sources increase. Increased Chlorophyll-a concentrations can also affect water clarity, causing Secchi-disk transparency to decrease (worsen) and turbidity to increase (worsen). Therefore, it is extremely important for volunteer monitors to continually educate all watershed

2009

residents about management practices that can be implemented to minimize phosphorus loading to surface waters.

Horseshoe Pond, Canterbury

Figure 1. Monthly and Historical Chlorophyll-a Results

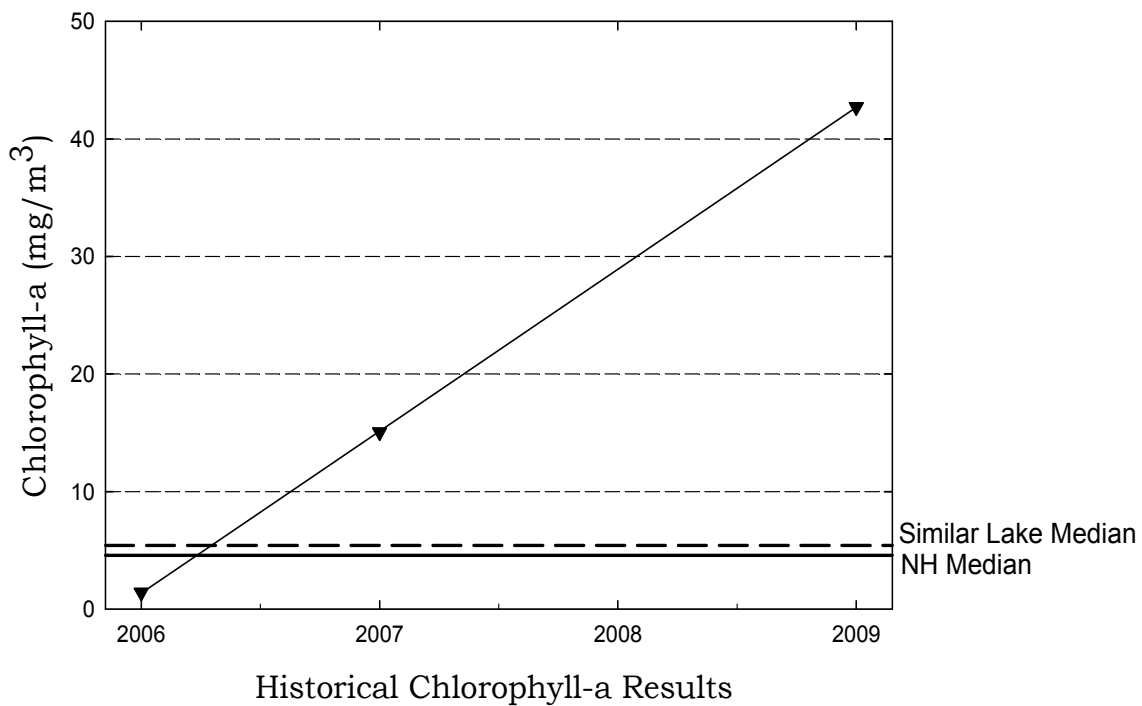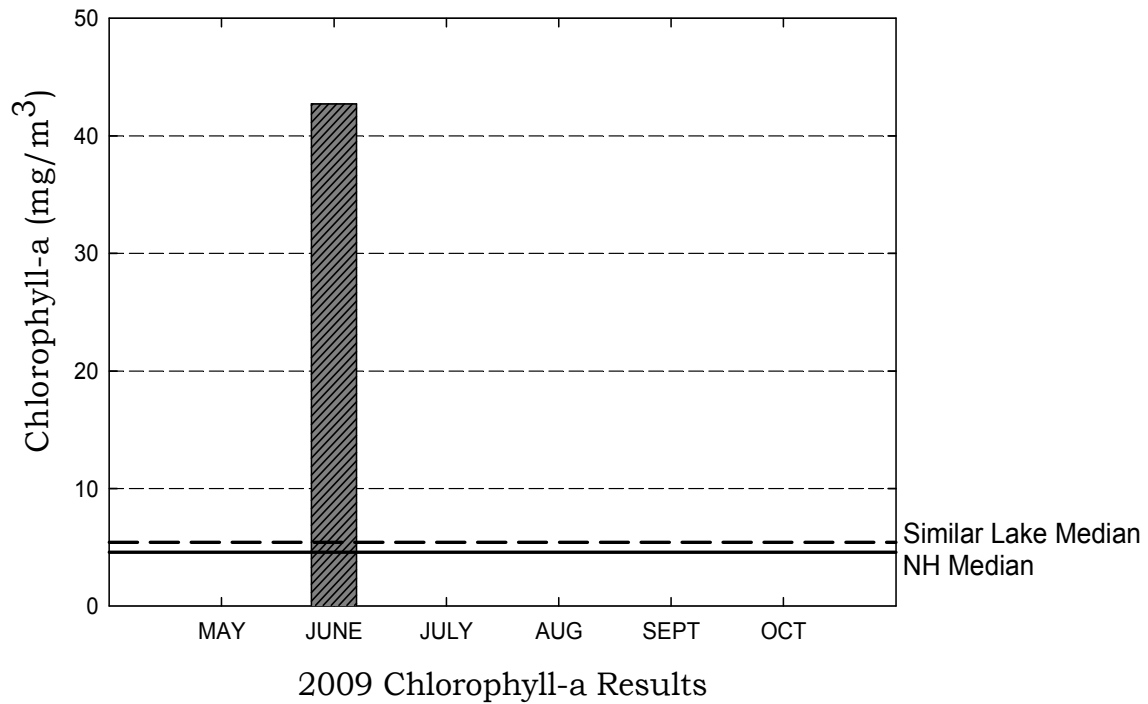

➤ **Phytoplankton and Cyanobacteria**

Table 1 lists the phytoplankton (algae) and/or cyanobacteria observed in the pond in **2009**. Specifically, this table lists the three most dominant phytoplankton and/or cyanobacteria observed and their relative dominance in the sample.

A biologist visit was not conducted in 2009; therefore a phytoplankton sample was not collected. Please contact the VLAP Coordinator in early 2010 to schedule a biologist visit.

Phytoplankton populations undergo a natural succession during the growing season. Please refer to the “Biological Monitoring Parameters” section of this report for a more detailed explanation regarding seasonal plankton succession. Diatoms and golden-brown algae populations are typical in New Hampshire’s less productive lakes and ponds.

➤ **Secchi Disk Transparency**

Volunteer monitors use the Secchi disk, a 20 cm disk with alternating black and white quadrants, to measure how far a person can see into the water. Transparency, a measure of water clarity, can be affected by the amount of algae and sediment in the water, as well as the natural color of the water. Table 14 in Appendix A lists the current year transparency data. **The median summer transparency for New Hampshire’s lakes and ponds is 3.2 meters.**

Figure 2 depicts the historical and current year transparency *with and without* the use of a viewscope.

The current year ***non-viewscope*** in-lake transparency was **1.6 meters in June**.

The historical data (the bottom graph) show that the **2009** mean non-viewscope transparency is ***much less than*** the state median and is ***slightly less than*** the similar lake median. Please refer to Appendix D for more information about the similar lake median.

Visual inspection of the historical data trend line (the bottom graph) shows a ***stable*** trend. Specifically, the transparency has ***remained approximately the same*** since monitoring began in **2006**.


Please keep in mind that this observation is based on only ***three non-consecutive*** years of ***limited*** data. After 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the historical data to objectively determine if there has been a significant change in the annual mean transparency since monitoring began.

Typically, high intensity rainfall causes sediment-laden stormwater runoff to flow into surface waters, thus increasing turbidity and decreasing clarity.


Efforts should continually be made to stabilize stream banks, pond shorelines, disturbed soils within the watershed, and especially dirt roads located immediately adjacent to the edge of tributaries and the pond. Guides to best management practices that can be implemented to reduce, and possibly even eliminate, nonpoint source pollutants, are available from DES upon request.

Horseshoe Pond, Canterbury

Figure 2. Monthly and Historical Transparency Results

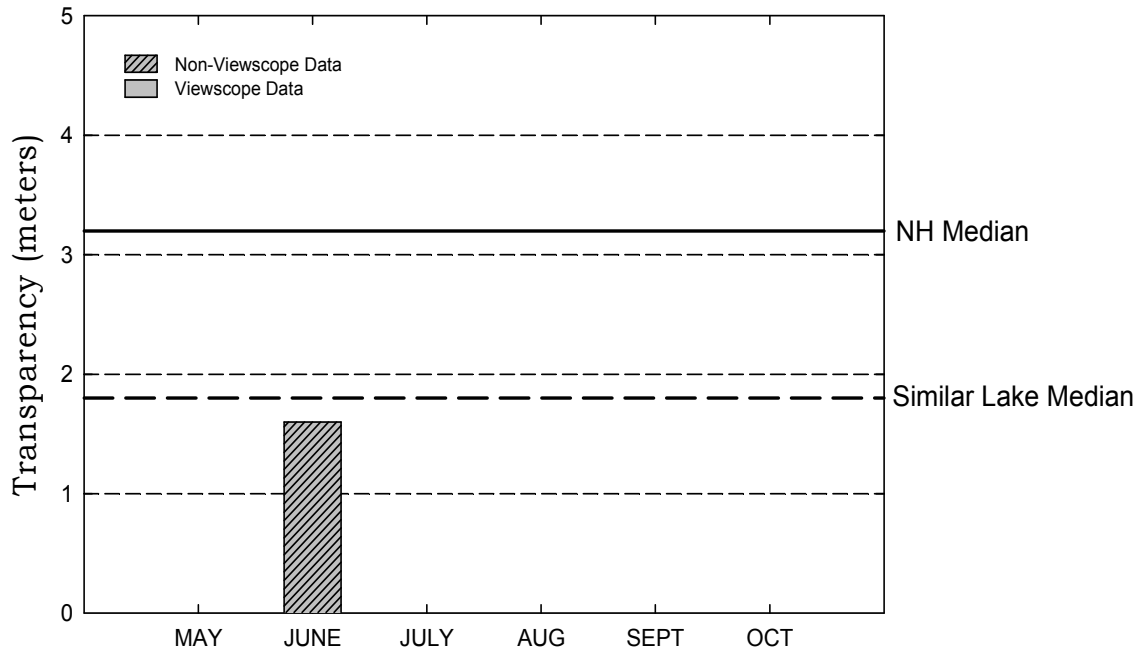

2009 Transparency Viewscope and Non-Viewscope Results

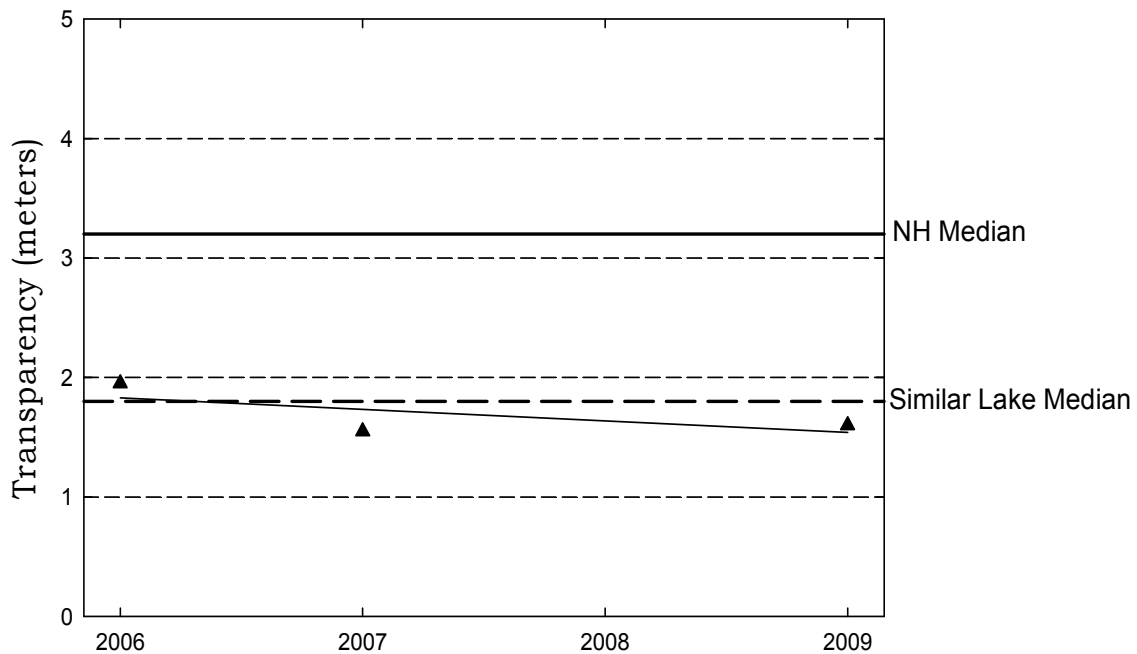

Historical Transparency Non-Viewscope Results

➤ **Total Phosphorus**

Phosphorus is typically the limiting nutrient for vascular plant and algae growth in New Hampshire's lakes and ponds. Excessive phosphorus in a pond can lead to increased plant and algal growth over time. Table 14 in Appendix A lists the current year total phosphorus data for in-lake and tributary stations.

The median summer total phosphorus concentration in the epilimnion (upper layer) of New Hampshire's lakes and ponds is 12 ug/L. The median summer phosphorus concentration in the hypolimnion (lower layer) is 14 ug/L.

The graphs in Figure 3 depict the historical amount of epilimnetic (upper layer) and hypolimnetic (lower layer) total phosphorus concentrations; the inset graphs depict current year total phosphorus data.

The current year data for the epilimnion (the top inset graph) show that the phosphorus concentration was **21ug/L** in **June**.

The hypolimnetic phosphorus concentration was not measured this year. The pond does not thermally stratify into distinct thermal layers; therefore a hypolimnion sample is not necessary.

The historical data show that the **2009** mean epilimnetic phosphorus concentration is **greater than** the state and similar lake medians. Refer to Appendix D for more information about the similar lake median.



Overall, visual inspection of the epilimnetic historical data trend line shows a **variable** phosphorus trend. Specifically, the mean annual epilimnetic phosphorus concentration has **fluctuated between approximately 18 and 32 ug/L** since monitoring began in **2006**.

As discussed previously, after 10 consecutive years of sample collection, we will be able to conduct a statistical analysis of the historical data to objectively determine if there has been a significant change in the annual mean phosphorus concentration since monitoring began.

One of the most important approaches to reducing phosphorus loading to a waterbody is to continually educate watershed residents about the watershed sources of phosphorus and how excessive phosphorus loading can negatively affect the ecology and the recreational, economical, and ecological value of lakes and ponds.

Horseshoe Pond, Canterbury

Figure 3. Monthly and Historical Total Phosphorus Data.

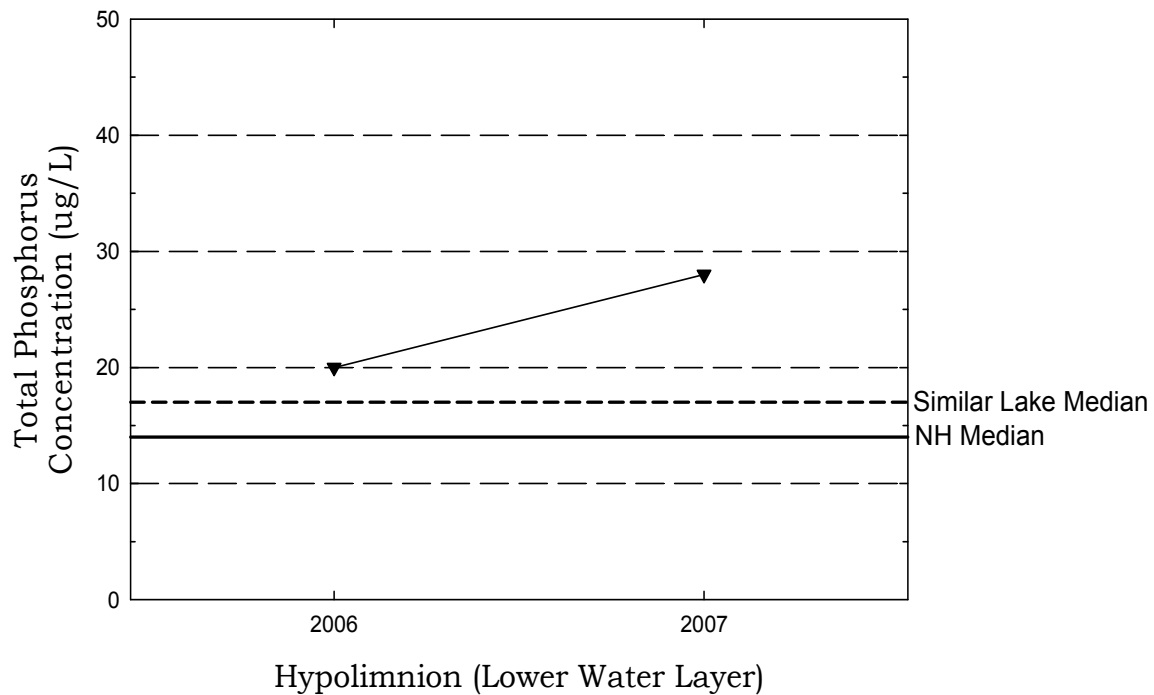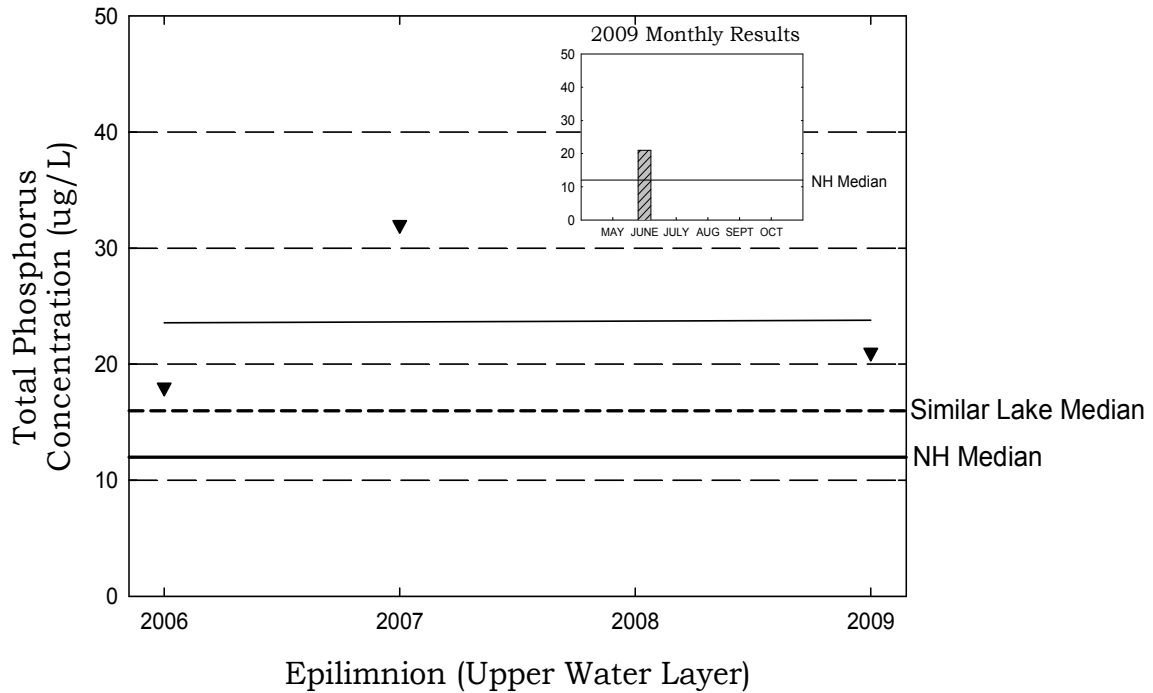

➤ pH

Table 14 in Appendix A presents the current year pH data for the in-lake stations.

pH is measured on a logarithmic scale of 0 (acidic) to 14 (basic). pH is important to the survival and reproduction of fish and other aquatic life. A pH below 6.0 typically limits the growth and reproduction of fish. A pH between 6.0 and 7.0 is ideal for fish. The median pH value for the epilimnion (upper layer) in New Hampshire's lakes and ponds is **6.6**, which indicates that the state surface waters are slightly acidic. For a more detailed explanation regarding pH, please refer to the "Chemical Monitoring Parameters" section of this report.

The pH at the deep spot this year was **6.32** in the epilimnion which means that the water is ***slightly acidic***.

Due to the state's abundance of granite bedrock and acid deposition received from snowmelt, rainfall, and atmospheric particulates, there is little that can be feasibly done to effectively increase pond pH. The pH at the deep spot, however, is sufficient to support aquatic life.

➤ Acid Neutralizing Capacity (ANC)

Table 14 in Appendix A presents the current year epilimnetic ANC for the deep spot.

Buffering capacity (ANC) describes the ability of a solution to resist changes in pH by neutralizing the acidic input. The median ANC value for New Hampshire's lakes and ponds is **4.9 mg/L**, which indicates that many lakes and ponds in the state are at least "moderately vulnerable" to acidic inputs. For a more detailed explanation about ANC, please refer to the "Chemical Monitoring Parameters" section of this report.

The acid neutralizing capacity (ANC) of the epilimnion (upper layer) was **5.4 mg/L**. This indicates that the pond is ***moderately vulnerable*** to acidic inputs.

➤ Conductivity

Table 14 in Appendix A presents the current conductivity data for in-lake stations.

Conductivity is the numerical expression of the ability of water to carry an electric current, which is determined by the number of negatively charged ions from metals, salts, and minerals in the water column. The median conductivity value for New Hampshire's lakes and ponds is **40.0 uMhos/cm**. For a more detailed explanation, please refer to the "Chemical Monitoring Parameters"

section of this report.

The conductivity in the pond is relatively **stable** and **low**. Typically conductivity levels greater than 100 uMhos/cm indicate the influence of pollutant sources associated with human activities. These sources include septic system leachate, agricultural runoff, and road runoff which contains road salt during the spring snow-melt. We hope this trend continues!

It is possible that de-icing materials applied to nearby roadways during the winter months may be influencing the conductivity in the pond. In New Hampshire, the most commonly used de-icing material is salt (sodium chloride).

Therefore, we recommend that the **epilimnion** (upper layer) be sampled for chloride next year. This additional sampling may help us identify what areas of the watershed are contributing to the increasing in-lake conductivity.

Please note that the DES Limnology Center in Concord is able to conduct chloride analyses, free of charge. As a reminder, it is best to conduct chloride sampling in the spring as the snow is melting and during rain events.

➤ **Dissolved Oxygen and Temperature**

Table 9 in Appendix A depicts the dissolved oxygen/temperature profile(s) collected during **2009**.

The presence of sufficient amounts of dissolved oxygen in the water column is vital to fish and amphibians and also to bottom-dwelling organisms. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation.

A biologist visit was not conducted in 2009; therefore a dissolved oxygen profile was not collected. Please contact the VLAP Coordinator early in 2010 to schedule a biologist visit.

➤ **Turbidity**

Table 14 in Appendix A presents the current year data for in-lake turbidity.

Turbidity in the water is caused by suspended matter, such as clay, silt, and algae. Water clarity is strongly influenced by turbidity. Please refer to the “Other Monitoring Parameters” section of this report for a more detailed explanation.

The deep spot turbidity was **relatively low** this year, which is good news.

However, we recommend that your group sample the pond and any surface water runoff areas during significant rain events to determine if stormwater

runoff contributes turbidity and phosphorus to the pond.

For a detailed explanation on how to conduct rain event sampling, please refer to the 2002 VLAP Annual Report special topic article, which is posted on the VLAP website at

<http://www.des.nh.gov/organization/divisions/water/wmb/vlap/categories/publications.htm>, or contact the VLAP Coordinator.

TRIBUTARY SAMPLING

➤ **Total Phosphorus**

Table 14 in Appendix A presents the current year total phosphorus data for tributary stations. Please refer to the “Chemical Monitoring Parameters” section of the report for a detailed explanation of total phosphorus.

The phosphorus concentration in the **East Inlet** sample on the **June** sampling event was **elevated (54 ug/L)**, however, the turbidity was **not elevated (1.96 NTUs)**.

It had rained approximately **0.5 inches** during the **24-72 hours** prior to the **June** sampling event. It is possible that watershed wetland systems were releasing phosphorus-enriched water into the lake from tributaries that drain the wetland area. Also, rain events typically carry phosphorus laden watershed runoff to tributaries. Phosphorus sources in the watershed can include agricultural runoff, failing or marginal septic systems, stormwater runoff, road runoff, and watershed development.

The phosphorus concentration in the **Southeast Inlet** sample on the **June** sampling event was **elevated (120 ug/L)**, and the turbidity was also **elevated (5.98 NTUs)**. Elevated turbidity levels are most often a result of sediment and/or organic material present in the sample. These materials typically contain attached phosphorus and when present in elevated amounts contribute to elevated tributary phosphorus levels.

These tributaries have a history of **elevated and fluctuating** phosphorus concentrations. We recommend that your monitoring conduct a stream survey and bracket sampling of the tributaries to determine the sources of elevated phosphorus concentrations.

To learn how to conduct a tributary survey, please refer to the 2004 special topic article, which is posted on the VLAP website at <http://www.des.nh.gov/organization/divisions/water/wmb/vlap/categories/publications.htm>, or contact the VLAP Coordinator.

➤ **pH**

Table 14 in Appendix A presents the current year pH data for the tributary stations. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation of pH.

The pH of the **East Inlet** was **6.62 (> 6)** and is sufficient to support aquatic life.

The pH of the **Southeast Inlet** appears to be slightly acidic. This can be caused by the presence of humic, tannic and fulvic acids. Humic, tannic and

fulvic acids naturally occur as a result of decomposing organic matter such as leaves. These acids may also cause the water to be tea colored. In New Hampshire the presence of granite bedrock and acid deposition also naturally lowers the pH of freshwaters.

➤ **Conductivity**

Table 14 in Appendix A presents the current conductivity data for the tributary stations. Please refer to the “Chemical Monitoring Parameters” section of the report for a more detailed explanation of conductivity.

The **East Inlet** has experienced slightly elevated conductivity since monitoring began. We recommend that your monitoring group conduct a conductivity survey of tributaries with **elevated** conductivity and along the shoreline of the pond to help identify the sources of conductivity. As previously mentioned increasing conductivity typically indicates the influence of pollutant sources associated with human activities.

For a detailed explanation on how to conduct rain event sampling and stream surveys, please refer to the 2002 VLAP Annual Report special topic article, which is posted on the VLAP website at

<http://www.des.nh.gov/organization/divisions/water/wmb/vlap/categories/publications.htm>, or contact the VLAP Coordinator.

It is possible that de-icing materials applied to nearby roadways during the winter months may be influencing the conductivity in the tributaries. In New Hampshire, the most commonly used de-icing material is salt (sodium chloride).

Therefore, we recommend that the **tributaries** be sampled for chloride next year. This additional sampling may help us identify what areas of the watershed are contributing to the increasing in-lake conductivity.

Please note that the DES Limnology Center in Concord is able to conduct chloride analyses, free of charge. As a reminder, it is best to conduct chloride sampling in the spring as the snow is melting and during rain events.

➤ **Turbidity**

Table 14 in Appendix A presents the current year turbidity data for the tributary stations. Please refer to the “Other Monitoring Parameters” section of the report for a more detailed explanation of turbidity.

The **Southeast Inlet** experienced turbid conditions in **June**, likely the result of stormwater runoff from significant rain events prior to sampling. Rainfall creates runoff that washes sediment and organic materials into tributaries causing turbid water conditions. Eventually, the suspended solids settle out once the flow is reduced or the tributary flow enters the lake.

➤ **Bacteria (*E. coli*)**

Table 14 in Appendix A lists the current year data for bacteria (*E.coli*) testing. *E. coli* is a normal bacterium found in the large intestine of humans and other warm-blooded animals. *E.coli* is used as an indicator organism because it is easily cultured and its presence in the water, in defined amounts, indicates that sewage **may** be present. If sewage is present in the water, potentially harmful disease-causing organisms **may** also be present. Please refer to the “Other Monitoring Parameters” section of the report for a more detailed explanation.

The *E. coli* concentration was **very low** at each station sampled on the **June** sampling event. Specifically, each result was **10 counts or less**, which is ***much less than*** the state standard of 406 counts per 100 mL for recreational surface waters that are not designated public beaches and 88 counts per 100 mL for surface waters that are designated public beaches.

➤ **Chlorides**

Table 14 in Appendix A lists the current year data for chloride sampling. The chloride ion (Cl⁻) is found naturally in some surface waters and groundwaters and in high concentrations in seawater. Research has shown that elevated chloride levels can be toxic to freshwater aquatic life. In order to protect freshwater aquatic life in New Hampshire, the state has adopted **acute and chronic** chloride criteria of **860 and 230 mg/L** respectively. The chloride content in New Hampshire lakes is naturally low, generally less than 2 mg/L in surface waters located in remote areas away from habitation. Higher values are generally associated with salted highways and, to a lesser extent, with septic inputs. Please refer to the “Chemical Monitoring Parameters” section of this report for a more detailed explanation.

Chloride sampling was **not** conducted during **2009**.

DATA QUALITY ASSURANCE AND CONTROL

Annual Assessment Audit

A biologist visit was not conducted in 2009; therefore an annual assessment audit was not performed.

Please contact the VLAP Coordinator early in 2010 to schedule the annual biologist visit.

During the annual visit to your pond, the biologist will train your group how to collect samples at the deep spot, tributaries, and the outlet. The biologist will conduct a “Sampling Procedures Assessment Audit” of your monitoring group during the annual visit. Specifically, the biologist will observe the performance

of your monitoring group while sampling and will document the ability of the volunteer monitors to follow the proper field sampling procedures (as outlined in the VLAP Monitor's Field Manual). This assessment is used to identify any aspects of sample collection in which volunteer monitors fail to follow proper procedures, and also provides an opportunity for the biologist to retrain the volunteer monitors as necessary. This will ultimately ensure that the samples that the volunteer monitors collect are truly representative of actual lake and tributary conditions.

Sample Receipt Checklist

Each time your monitoring group dropped off samples at the laboratory this summer, the laboratory staff completed a sample receipt checklist to assess and document if your group followed proper sampling techniques when collecting the samples. The purpose of the sample receipt checklist is to minimize, and hopefully eliminate, improper sampling techniques.

Overall, the sample receipt checklist showed that your monitoring group did an **excellent** job when collecting samples and submitting them to the laboratory this year! Specifically, the members of your monitoring group followed the proper field sampling procedures and there was no need for the laboratory staff to contact your group with questions, and no samples were rejected for analysis.

USEFUL RESOURCES

Best Management Practices to Control Nonpoint Source Pollution: A Guide for Citizens and Town Officials, DES Booklet WD-03-42, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/publications/wd/documents/wd-03-42.pdf.

Erosion Control for Construction in the Protected Shoreland Buffer Zone, DES fact sheet WD-SP-1, (603) 271-2975 or <http://des.nh.gov/organization/commissioner/pip/factsheets/sp/documents/sp-1.pdf>

Lake Protection Tips: Some Do's and Don'ts for Maintaining Healthy Lakes, DES fact sheet WD-BB-9, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/factsheets/bb/documents/bb-9.pdf.

NH Stormwater Management Manual Volume 1: Stormwater and Antidegradation, DES fact sheet WD-08-20A, (603) 271-2975 or <http://des.nh.gov/organization/commissioner/pip/publications/wd/documents/wd-08-20a.pdf>

NH Stormwater Management Manual Volume 2: Post-Construction Best Management Practices Selection and Design, DES fact sheet WD-08-20B, (603) 271-2975 or <http://des.nh.gov/organization/commissioner/pip/publications/wd/documents/wd-08-20b.pdf>

NH Stormwater Management Manual Volume 3: Erosion and Sediment Controls During Construction, DES fact sheet WD-08-20C, (603) 271-2975 or <http://des.nh.gov/organization/commissioner/pip/publications/wd/documents/wd-08-20c.pdf>

Road Salt and Water Quality, DES fact sheet WD-WMB-4, (603) 271-2975 or www.des.nh.gov/organization/commissioner/pip/factsheets/wmb/documents/wmb-4.pdf.

Vegetation Maintenance Within the Protected Shoreland, DES fact sheet WD-SP-5, (603) 271-2975 or <http://des.nh.gov/organization/commissioner/pip/factsheets/sp/documents/sp-5.pdf>